

Programmable Multi-Axis Controller

Startup Guide for ZW Confocal Fiber Displacement Sensors

CK3E-□□□□
NY51□-A□□□

Startup Guide



About Copyrights and Trademarks

Microsoft product screen shots are reprinted with permission from Microsoft Corporation.

Windows is a registered trademark of Microsoft Corporation in the United States and other countries.

EtherCAT® is a patented technology and registered trademark licensed by Beckhoff Automation GmbH, Germany.

Sysmac is a trademark or registered trademark of OMRON Corporation in Japan and other countries for OMRON factory automation products.

Company names and product names in this document are trademarks or registered trademarks of their respective companies.

Contents

1.	Related Manuals	4
2.	Terms and Definitions	5
3.	Precautions	6
4.	Overview	7
5.	Applicable Devices and Device Configuration	8
5.1.	Applicable Devices	8
5.2.	Device Configuration	9
6.	EtherCAT Connection Procedure	10
6.1.	Workflow	10
6.2.	Preparation for the Controller Setup	11
6.3.	Installation of ESI Files	16
6.4.	EtherCAT Communications Setup	18
6.5.	Controller Settings	23
7.	Appendix Saving and Loading a Project	30
7.1.	Saving a Project	30
7.2.	Loading and Downloading a Project	31
8.	Appendix Troubleshooting	34
8.1.	Factors Causing EtherCAT Communications To Be Unavailable,	
	and Corrective Actions	34
8.2.	How to Check for Errors	35
9.	Appendix ECAT[i] Structure Elements	38
10.	Revision History	39

1. Related Manuals

To ensure system safety, always read and follow the information provided in all *Safety Precautions* and *Precautions for Safe Use* in the manuals for the devices that are used in the system.

The following shows the manuals for OMRON Corporation (hereafter referred to as OMRON) and Delta Tau Data Systems, Inc (DT).

Manufacturer	Manual No.	Model	Manual name
OMRON	I610-E1	Model CK3E-□□□□	Programmable Multi-Axis Controller
			Hardware User's Manual
OMRON	W580-E1	Model NY51□-A□□□	Industrial PC Platform NY-series IPC
			Programmable Multi-Axis Controller
			Hardware User's Manual
OMRON	Z332-E1	Model ZW-CE1□	ZW-CE1□ Confocal Fiber Type
			Displacement Sensor User's Manual
DT	O014-E	-	Power PMAC User's Manual
DT	O015-E	-	Power PMAC Software Reference
			Manual
DT	O016-E	-	Power PMAC IDE Users Manual

2. Terms and Definitions

Term	Explanation and Definition
Slave	Slaves are devices connected to EtherCAT. There are various types of
	slaves such as servo drivers handling position data and I/O terminals
	handling the bit signals.
Object	Represents information such as in-slave data and parameters.
PDO	One type of EtherCAT communications in which Process Data Objects
communications	(PDOs) are used to exchange information cyclically and in real time.
(Communications	This is also called "process data communications".
using Process Data	
Objects)	
PDO Mapping	The association of objects used for PDO communications.
PDO Entry	PDO entries are the pointers to individual objects used for PDO
	mapping.
ESI file	An ESI file contains information unique to the EtherCAT slaves in XML
(EtherCAT Slave	format.
Information file)	You can load ESI files into the EC-Engineer, to easily allocate slave
	process data and make other settings.
ENI file	An ENI file contains the network configuration information related to
(EtherCAT Network	EtherCAT slaves.
Information file)	
Power PMAC IDE	This computer software is used to configure the Controller, create user
	programs, and monitor the programs.
	PMAC is an acronym for Programmable Multi-Axis Controller.
Acontis	This computer software is used to configure the EtherCAT network and
EC-Engineer	each slave.

3. Precautions

- (1) Understand the specifications of devices that are used in the system. Allow some margin for ratings and performance. Provide safety measures, such as for installing a safety circuit, in order to ensure safety and minimize the risk of abnormal occurrences.
- (2) To ensure system safety, always read and follow the information provided in all *Safety Precautions* and *Precautions for Safe Use* in the manuals for each device that is used in the system.
- (3) The user is encouraged to confirm the standards and regulations that the system must conform to.
- (4) It is prohibited to copy, reproduce, or distribute a part or the whole of this document without the permission of OMRON Corporation.
- (5) The information contained in this document is current as of July 2016. It is subject to change without prior notice for improvement purposes.

The following notations are used in this document.



Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury, or may result in serious injury or death. Additionally, there may be severe property damage.



Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury, or property damage.



Precautions for Correct Use

Precautions on what to do and what not to do to ensure correct operation and performance.



Additional Information

Additional information to read as required.

This information is provided to increase understanding or make operations easier.

Symbols



The filled circle symbol indicates operations that you must carry out.

The specific operation is shown in the circle and explained in text.

This example indicates a "general precaution" for something that you must carry out.

4. Overview

This document describes the procedures used to connect the OMRON Confocal Fiber Type Displacement Sensor Controller Equipped with EtherCAT model ZW-CE1 \square (hereafter referred to as the Slave) using OMRON Programmable Multi-Axis Controller model CK3E- $\square\square\square$ /NY51 \square -A $\square\square\square$ (hereafter referred to as the Controller) and EtherCAT, as well as for checking the connection.

Refer to Section 6. EtherCAT Connection Procedure to learn about the setting methods and key points to perform PDO communications via EtherCAT.

5. Applicable Devices and Device Configuration

5.1. Applicable Devices

The applicable devices are as follows:

Manufacturer	Name	Model	
OMRON	Programmable Multi-Axis Controller	Model CK3E-□□□□	
OMRON	Programmable Multi-Axis Controller Model NY51□-A□□□		
	Industrial Box PC		
OMRON	Confocal Fiber Type Displacement Sensor	Model ZW-CE1□	
	Controller Equipped with EtherCAT	IVIOGEI ZVV-CE I	



Precautions for Correct Use

In this document, the devices with models and versions listed in *Section 5.2* are used as examples of applicable devices to describe the procedures to connect the devices and check their connections.

You cannot use devices with versions lower than the versions listed in Section 5.2.

To use the devices mentioned above with models not listed in *Section 5.2* or versions higher than those listed in *Section 5.2*, check the differences in the specifications by referring to the manuals before operating the devices.




Additional Information

This document describes the procedures to establish the network connections. It does not provide information on operations, installations, wiring methods, device functionalities, or device operations, which are not related to the connection procedures. For more information, refer to the manuals or contact your OMRON representative.

5.2. Device Configuration

The hardware components to reproduce the connection procedures in this document are as follows:

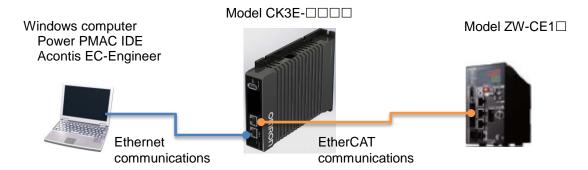

Manufacturer	Name	Model	Version
OMRON	Programmable Multi-Axis Controller	Model CK3E-□□□□	Ver.2.2
OMRON	Confocal Fiber Type Displacement Sensor Controller Equipped with EtherCAT	Model ZW-CE1□	Ver. 1.1
OMRON	Ethernet cable (with industrial Ethernet connector)	Model XS5W-T421-□M□-K	
-	Windows computer	-	
DT	Power PMAC IDE	-	Ver. 2.2
Acontis	Acontis EC-Engineer	-	Ver. 2.4.3



Precautions for Correct Use

Prepare the ESI file described in this section in advance. Contact your OMRON representative for information on how to procure the ESI file.



Precautions for Correct Use

Do not share the connection line of EtherCAT communications with other Ethernet networks. Do not use devices for Ethernet such as a switching hub.

Use the Ethernet cable (double shielding with aluminum tape and braiding) of Category 5 or higher, and use the shielded connector of Category 5 or higher.

Connect the cable shield to the connector hood at both ends of the cable.



Additional Information

This document describes model CK3E- $\square\square\square$ as an example. The same procedures can apply to model NY51 \square -A $\square\square$.

6. EtherCAT Connection Procedure

This section describes the procedure for connecting the Controller with the Slave via EtherCAT. The description assumes that the Controller and the Slave are set to factory default.

6.1. Workflow

Take the following steps to operate the PDO communications via EtherCAT after connecting the Controller with the Slave via EtherCAT.

6.2 Preparation for the Controller Setup	Prepare the Controller settings.
▼	j
6.2.1 Creation of a New Project	
▼	
6.2.2 Initial Settings of the Controller	
∇	
6.3 Installation of ESI Files	Install the ESI file for the Slave into Acontis EC-Engineer.
riangle	
6.4 EtherCAT Communications Setup	Set up EtherCAT communications.
▼	
6.4.1 Communications Setup for the EtherCAT Master	
▼	
6.4.2 Distributed Clock Setup	
▼	
6.4.3 PDO Map Settings	
6.4.4 Creation of an EtherCAT Network Configuration File	
riangle	
6.5 Controller Settings	Set up the Controller.
▼	
6.5.1 EtherCAT Network Configuration Settings	
▼	
6.5.2 EtherCAT Communications Check	
▼	
6.5.3 EtherCAT Variables Settings	
▼	
6.5.4 Writing the User Program	
▼	
6.5.5 Project Data Transfer	

6.2. Preparation for the Controller Setup

Prepare the Controller settings.


Install Power PMAC IDE and Acontis EC-Engineer on the computer in advance.

6.2.1. Creation of a New Project

- 1 Connect the Controller with the computer via Ethernet cable.
- 2 Turn on the power to the Controller.
- Start Power PMAC IDE.
 - * If the dialog for confirming access rights appears upon start-up, select starting of Power PMAC IDE.




- The Communication screen appears. Specify the IP address of the destination Controller and click **Connect**.
 - * The IP address of the Controller is set to "192.168.0.200" by default.
 - * If necessary, change the Windows IP address to "192.168.0.X".

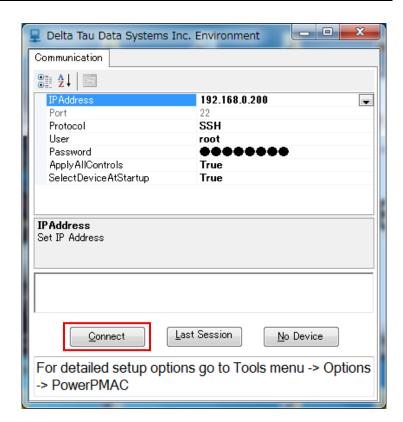


Power PMAC IDE starts, and is online to the Controller.



From the **File** menu, select **New** then **Project**.

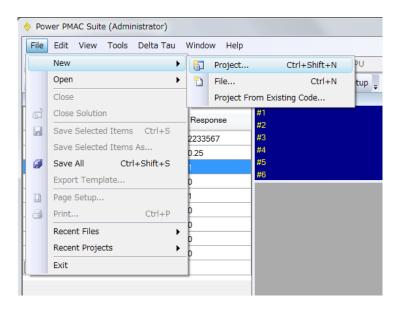

7 Enter a project name and location, and select **OK**.

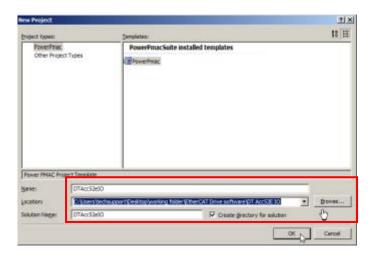

6.2.2. Initial Settings of the Controller


Configure the initial settings for the Controller.



Precautions for Correct Use

Configuring the initial settings clears all data in the Controller memory. Back up necessary data in advance.


1 In the Terminal pane, type the \$\$\$*** command to reset the Controller to factory default.

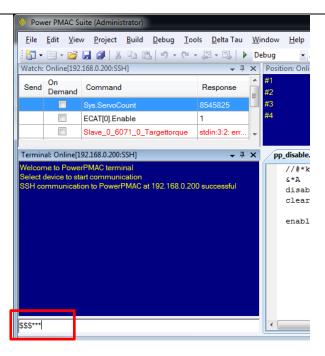


2 From the Tools menu, select
System Setup to start System
Setup.



PowerPMAC System Setup starts.

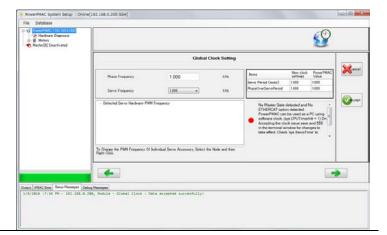


From the File menu of PowerPMAC System Setup, select New then Setup.

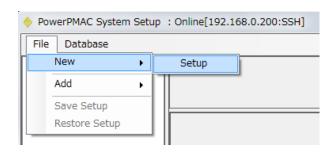


▲ Specify Servo Frequency.

Select the **Servo Frequency** setting from 4 KHz, 2 KHz, or 1 KHz.

* Servo Frequency is set to 1 kHz for the example in this document.

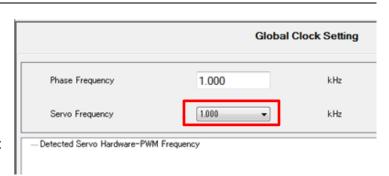

Click the **Accept** button.

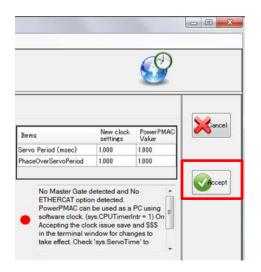

6 If you have changed the servo frequency setting, type the SAVE command in the Terminal pane of Power PMAC IDE.

When complete, the "Save Complete" message appears in the Terminal pane.



7 Click Communication Setup on the toolbar to display the Device Properties dialog box.



8 In the Device Properties dialog box, select *No Device* for IP Address, then click the **Apply** button.

This operation sets the Controller to the offline state.




The Controller restarts.

The servo frequency that has been set is reflected.

Wait until the startup process of the Controller is complete. Then click **Communication Setup** on the toolbar to display the Device Properties dialog box.

In the Device Properties dialog box, return the IP Address to the previous setting, then click the **Apply** button.

This operation sets the Controller to the online state.

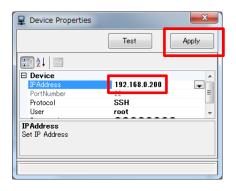


6.3. Installation of ESI Files

Install the ESI file for the Slave into Acontis EC-Engineer.




Precautions for Correct Use

Prepare the ESI file described in this section in advance. Contact your OMRON representative for information on how to procure the ESI file.

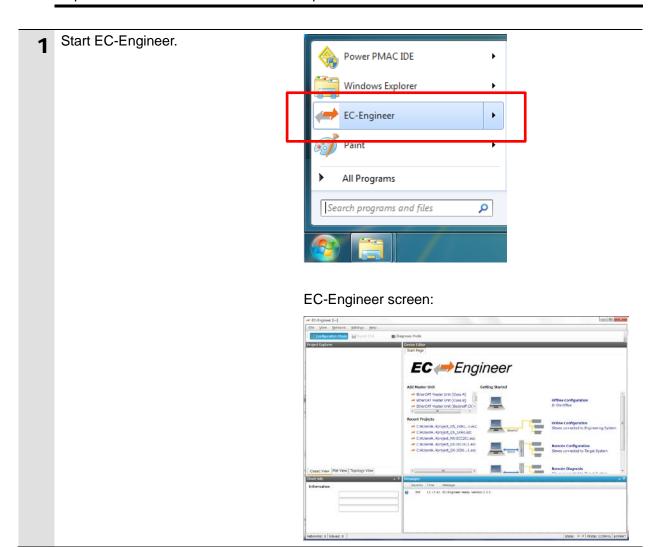


2 From the **File** menu of EC-Engineer, select **ESI Manager**.

The ESI Manager appears.

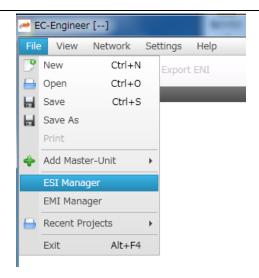



Example of the ESI Manager

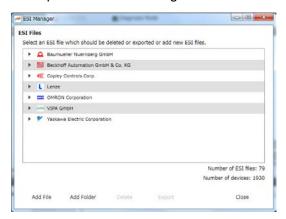

3 Confirm that *Omron ZW-CE1x.xml* is registered in the ESI file list of ESI Manager.

If it is not yet registered, click **Add File**and register *OmronZW-CE1x.xml*.

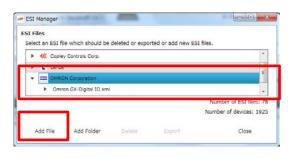

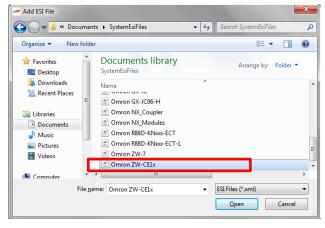

4 Click Close to close the ESI Manager page.

6.4. EtherCAT Communications Setup

Set up EtherCAT communications.




Precautions for Correct Use

Before taking the following steps, make sure that the devices are connected via an Ethernet cable. If they are not connected, turn OFF the power to the devices, and connect the Ethernet cable.

6.4.1. Communications Setup for the EtherCAT Master

- 1 Connect the Controller with slave devices using an Ethernet cable.
 - * Refer to the manuals for slave devices to configure them.
- Display Start Page of EC-Engineer, and select
 EtherCAT Master Unit (Class A) from Add Master Unit.

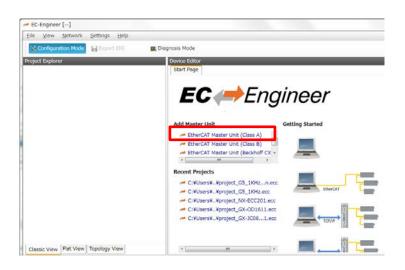


3 Class-A Master is added to the Project Explorer.



- In the Master page, specify a communication period for Cycle Time [us].
 - * You must specify the communication period in accordance with the servo frequency of the Controller.

 1000 us is set in this document.

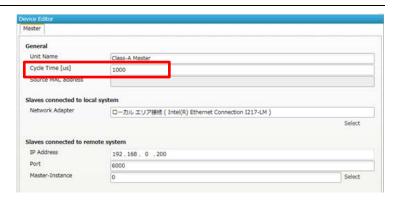


Correspondence between the servo frequencies of the Controller and communication periods is as follows:

4 kHz : 250 us 2 kHz : 500 us 1 kHz : 1000 us

- In the Master page, enter the IP address of the Controller in IP
 Address, and click the Select button to apply the setting.
 - * Default IP address "192.168.0.200" is specified in this example.
 - * Do not select **Slaves connected to local system** as it is not used.



6 Right-click on Class-A Master in the Project Explorer, and select Scan EtherCAT Network from the menu.

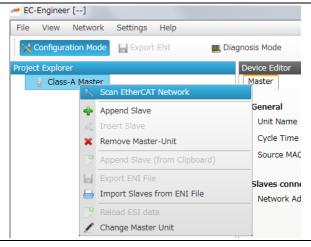


7 Make sure that the slave is displayed in the Project Explorer.




6.4.2. Distributed Clock Setup

1 Setting Distributed Clocks (DC) for Master


In the Project Explorer, select **Class-A Master** to display the Distributed Clocks tab page.

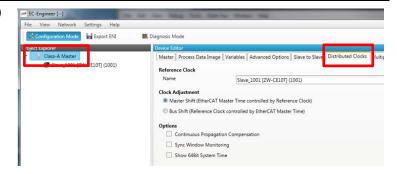

* If the Distributed Clocks tab does not appear, select **View** then the **Expert Mode** check box.

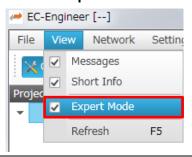


2 Select Master Shift (EtherCAT Master Time controlled by Reference Clock).

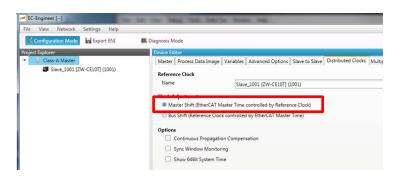


3 Setting Distributed Clock (DC) for the Slave

In the Project Explorer, select the target slave to display the Distributed Clocks tab page.

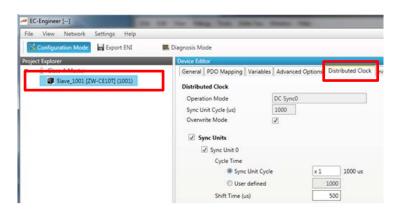

Select the Overwrite Mode check box and specify Shift Time.

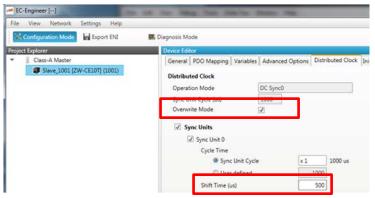


Correspondence between the servo frequencies of the Controller and **Shift Time** values is as follows:


4 kHz : 125 us 2 kHz : 250 us 1 kHz : 500 us

6.4.3. PDO Map Settings


1 In the Project Explorer, select the target slave to display the PDO Mapping tab page.

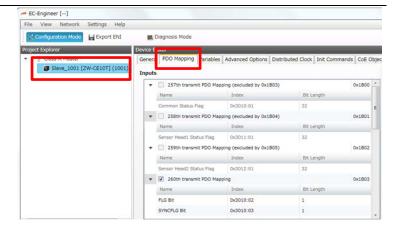

- Check the Inputs field to make sure that only the 260th transmit PDO Mapping 0x1B03 check box is selected.
 - * If you want to use other data, clear the currently displayed check boxes and select other desired check boxes.

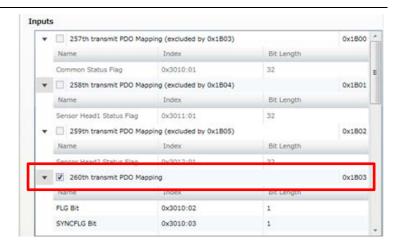

- 3 Check the Outputs field to make sure that only the 260th receive PDO Mapping 0x1703 check box is selected.
 - * If you want to use other data, clear the currently displayed check boxes and select other desired check boxes.

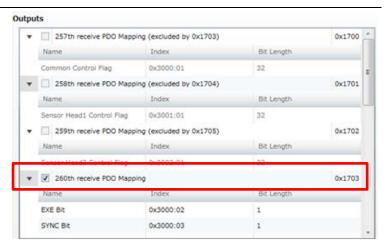


6.4.4. Creation of an EtherCAT Network Configuration File

Click Export ENI on the upper EC-Engineer [--] part of the EC-Engineer page. Network View Settings 🗶 Configuration Mode 📕 Export ENI Diagnosis Mode Enter a file name, and then click Export EtherCAT-Network-Information (ENI) File Save to create an EtherCAT Computer ➤ Local Disk (C:) ➤ tmp ▼ 👣 Search tmp م network configuration file. Organize 🔻 New folder ₩ -Local Disk (C:) Date modified Туре 📗 DeltaTau No items match your search. 📗 inetpub Intel OF-Downloade Omron PerfLogs Program Files Program Files (tmp File <u>n</u>ame: Save as type: EtherCAT-Network-Information (ENI) Files (*.xml) Hide Folders Save Cancel

6.5. Controller Settings

6.5.1. EtherCAT Network Configuration Settings

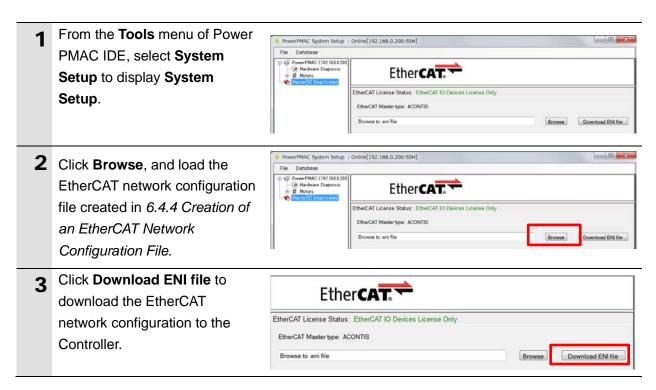

6.5.2. EtherCAT Communications Check


Take the following steps to ensure that EtherCAT communications are available.

1 From the Terminal pane, run the ECAT[0].Enable=1 command to start EtherCAT communications.




2 In the Terminal or Watch pane, make sure that the ECAT[0]. Enable value turns to 1.


* The OP mode is entered and EtherCAT communications are established.

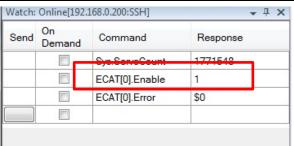

After making sure that correct communications are available, run the ECAT[0].Enable=0 command from the Terminal pane to stop EtherCAT communications.

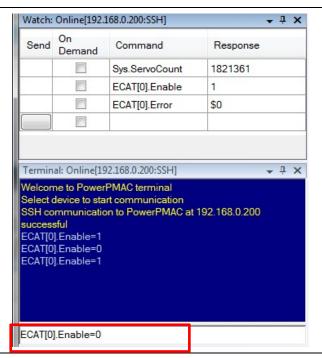

In the Terminal or Watch pane, make sure that the ECAT[0]. Enable value turns to 0.

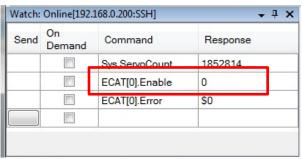

6.5.3. EtherCAT Variables Settings

In the System Setup page, PowerPMAC System Setup : Online[192.168.0.200:SSH] right-click on File Database Master[0].Deactivated to Ether CAT. display the pop-up menu, and # Motors 👈 Master[0] D select Export EtherCAT Export EtherCAT Variables EtherCAT IO Device Lineroal License Status Variables. EtherCAT Master type: ACONTIS Enter a name for the EtherCAT variable definition file for user Organize * New folder 8≡ ▼ • programs into the root of the Date modified * Favorites Desktop 7/8/2016 8:42 PM project folder. Downloads C Language 7/8/2016 8:42 PM File folder 7/8/2016 8:42 PM Documentation 7/8/2016 8:42 PM File folder Libraries 7/8/2016 8:42 PM Documents

Music PMAC Script Language 7/8/2016 8:42 PM File folder Pictures ₩ Videos Computer Local Disk (C:) File name: ECAT_Variables Save as type: ppmac header files (*.pmh) <u>Save</u> Cancel Hide Folders The created EtherCAT variable Position: Online[19... • 4 × | Velocity: Online[192.... • 4 × | Following Error: Onli... • 4 × | Solution Explorer - Solution '... • 4 × 0.00 mu 0.00 mu 0.00 mu 0.00 mu/msec #1 definition file is added to under 0.00 mu 0.00 mu 0.00 mu/msei 0.00 mu/msei Solution 'PowerPmac2' (1 project)
PowerPmac2(192.168.0.200:x **Global Includes of PMAC** E C Language Configuration
Documentation Script Language in Solution ecat_variables.h ecat_variables.pmh PMAC Script Language Explorer. e e global definitions 🛅 Kinematic Routines Motion Programs


- PLC Programs

6.5.4. Writing the User Program

Create programs to be used to check operations.

A specific language is used for the operation check programs. Refer to *Power PMAC User's Manual* and *Power PMAC Software Reference Manual* for details.

1 In the Solution Explorer pane, open Project name – PMAC Script Language – PLC Programs – plc1.plc.

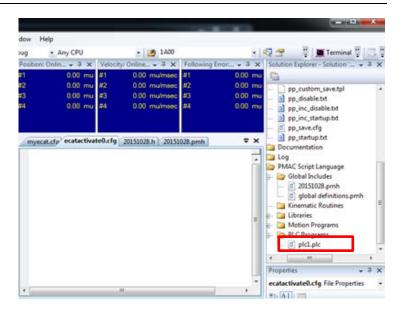

2 In the programming area of the plc1.plc tab page, write a program as shown on the right.


This sample program repeats the process of sending the command after one second, turning OFF the transmission bit after one second, sending the command after one second, then turning OFF the transmission bit after one second.

* In this example, PDO mapping is assumed to be the default setting. If you want to change PDO mapping, rewrite the "Slave_0...." description.

```
open plc 1
  while(sys.ecatMasterReady==0){};
  ECAT[0].Enable = 1;
  P1000 = Sys.Time + 1;
  while(P1000 > Sys.Time){};
  Slave_0_3003_0_Command = $00404000;
  Slave_0_3004_1_CommandParameter1 = 900;
  Slave_0_3000_2_EXEBit = 1;
  P1000 = Sys.Time + 1;
 while(P1000 > Sys.Time){};
 Slave_0_3000_2_EXEBit = 0;
  P1000 = Sys.Time + 1;
  while(P1000 > Sys.Time){};
  Slave 0 3003 0 Command = $00404000;
  Slave 0 3004 1 CommandParameter1 = 901;
  Slave 0 3000 2 EXEBit = 1;
  P1000 = Sys.Time + 1;
 while(P1000 > Sys.Time){};
  Slave_0_3000_2_EXEBit = 0;
close
```

3 Setting the start of the user program

In the Solution Explorer pane, open Project name – Configuration – pp_disable.txt.

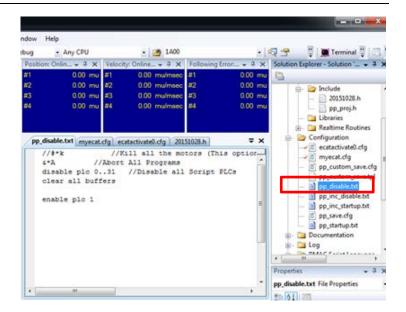

In the programming area of the pp_disable.txt tab page, add the program shown on the right to the last line.

enable plc 1;

The pp_disable.txt program is automatically executed when the Controller starts.

This example program runs the PLC1 script.

6.5.5. Project Data Transfer

Transfer the created project data to the Controller.

M WARNING

When the user program and "configuration and setting" data are transferred from Power PMAC IDE, devices or the machine may perform unexpected operations. Therefore, before you transfer project data, ensure the destination slave is operating safely.



⚠ Caution


Transferring project data restarts the Controller and interrupts communications with slaves. The time that communications are interrupted depends on the EtherCAT network configuration.



Before you transfer project data, make sure that the slave settings will not adversely affect the devices.


1 In the Terminal or Watch pane, make sure that the ECAT[0]. Enable value is 0.

If the value is 1, run the ECAT[0].Enable=0 command from the Terminal pane to stop EtherCAT communications.

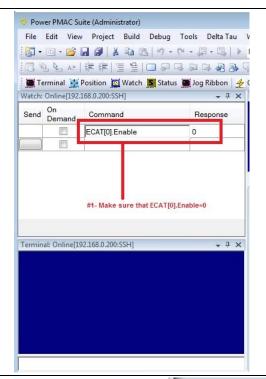

Downloading a project

Right-click the project name in the Solution Explorer pane on the upper right of the IDE screen, and select **Build and Download All Programs** to run the build and download.

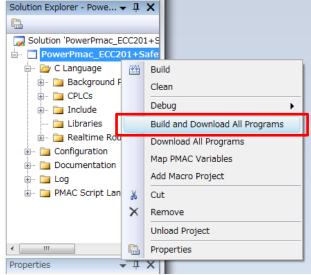

- **3** Make sure that there are no errors in the Output tab page.
 - * If the transfer fails, check details of the error in the Output tab page.


If the error is a program error, you must review the program. If the error is related to EtherCAT settings, return to System Setup and check whether there are any incorrect settings.

The program starts running when it has been downloaded successfully.

> EtherCAT communications are in the OP state. Make sure that the command is sent.

* If the command is not sent, check that the ECAT[0]. Enable value is 1 in the Terminal or Watch pane.

If the value is 0, run the following command from the Terminal pane. enable plc 1

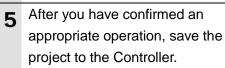

Run the save command from the Terminal pane.

* The transferred project is not yet saved to the Controller at this stage.

If you turn OFF the power to the Controller, the transferred project will be discarded.







7. Appendix Saving and Loading a Project

The following describes the procedures to save a Power PMAC IDE project on the computer, and to reuse it.


7.1. Saving a Project

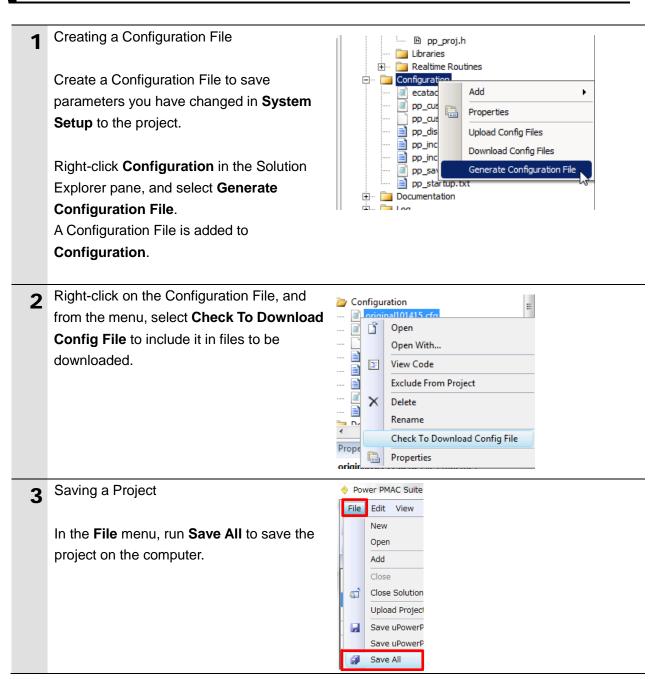

7.2. Loading and Downloading a Project

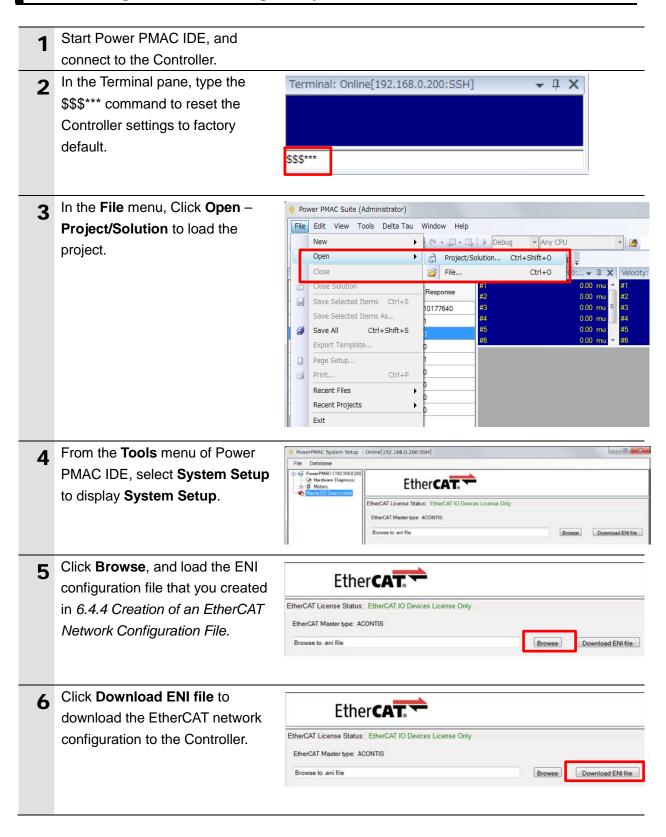


7 Right-click Configuration in the Solution Explorer pane, and select Download Config Files to download the file to the Controller.

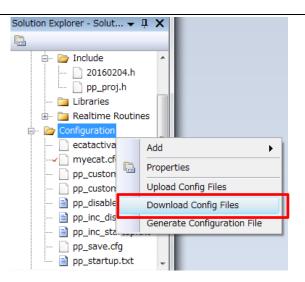

Right-click the project name in the Solution Explorer pane, and select Build and Download All Programs to run the build and download.


When the download process is complete, make sure that there are no errors in the Output tab page.

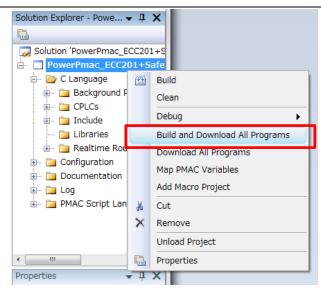


Stopping a program

If a program is running, execute the following command from the Terminal pane to stop the program. disable plc 1

disable plc 1 ECAT[0].Enable=0

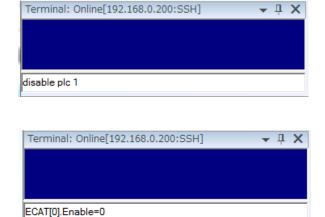

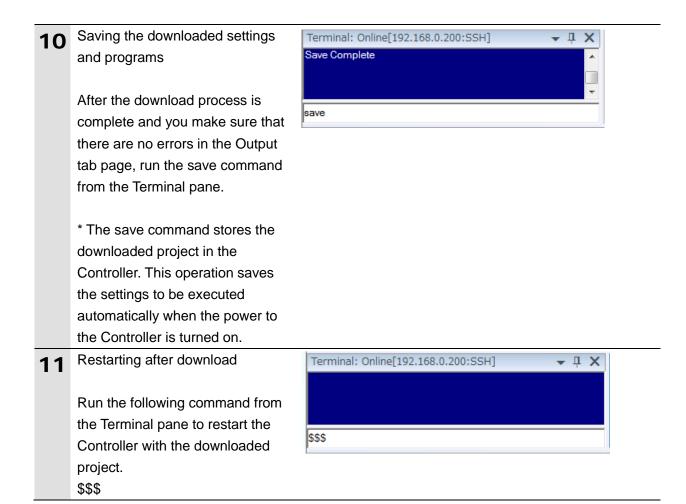

8. Appendix Troubleshooting

8.1. Factors Causing EtherCAT Communications To Be Unavailable, and Corrective Actions

Description	Factor	Corrective Action
The link is not established.	The Ethernet cable is broken or	If the Ethernet cable is broken
	the specified cable is not being	or if the specified cable was not
	used.	used, replace the cable.
	A connector on the Ethernet	Reconnect the connector and
	cable used for EtherCAT	make sure it is mated correctly.
	communications is	
	disconnected, the contact is	
	faulty, or parts are faulty.	
	A slave within the EtherCAT	Replace the slave.
	network configuration failed.	
EtherCAT communications do	ECAT[0].Enable is set to 0.	From the Terminal pane, run the
not start.		ECAT[0].Enable=1 command to
		start EtherCAT communications.
	The EtherCAT network	Review the settings according
	configuration in the Controller	to the procedures provided in
	does not agree with the	6.4 EtherCAT Communications
	physical network configuration.	Setup.
	The Ethernet cable is broken at	Connect the Ethernet cable
	a slave in the network, or a	correctly.
	connector is disconnected.	
	Some errors have occurred,	Check the ECAT[0].error value.
	and the ECAT[0].error is set to a	
	value other than 0.	
A synchronization error occurs	The distribution clock is not set	Review the settings according
at a slave.	correctly.	to the procedures provided in
	A slave in Free-Run Mode is set	6.4.2 Distributed Clock Setup.
	to the reference clock.	
	The servo task processing time	Review the program or servo
	exceeds the set period.	frequency to adjust it, so that
		the servo task processing time
		does not exceed the period.


8.2. How to Check for Errors

8.2.1. Checking the EtherCAT Status

You can check the EtherCAT status from **System Setup** of Power PMAC IDE and **Diagnosis Mode** of Acontis EC-Engineer.


■ System Setup of Power PMAC IDE

You can check the status of the EtherCAT master and slaves in the System Setup page of Power PMAC IDE.

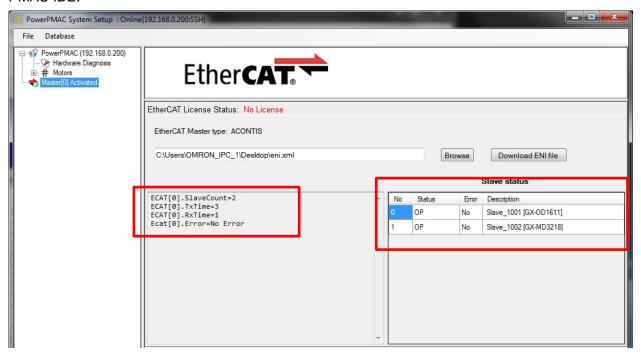


■ Diagnosis Mode of Acontis EC-Engineer

You can check the status of the slaves in the Diagnosis Mode page of Acontis EC-Engineer.

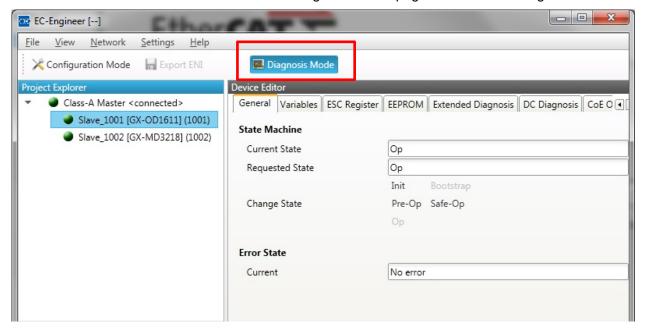

Select Network then Network Mismatch Analyzer from the menu to verify the network configuration.

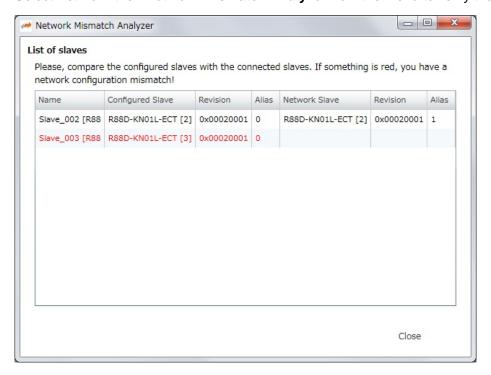


8.2.2. Checking the Controller Status

In the Status page of Power PMAC IDE, you can check the status of the motor, coordinate system, and system.

To display the Status page, click **Status** on the toolbar.


■ Global Status

You can check system errors such as the WDT error.

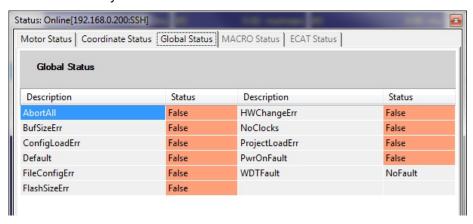


■ Motor Status

You can check deviation errors, limit errors, and other states of the motor.

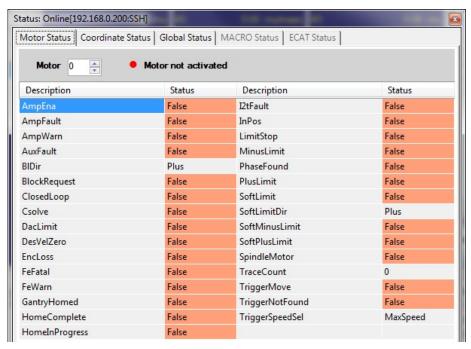

■ Coordinate Status

You can check deviation errors, limit errors and other states of the coordinate system.

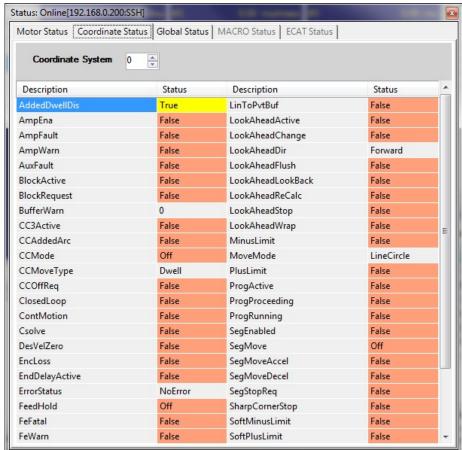

9. Appendix ECAT[i] Structure Elements

The Controller uses motion controller technology developed by Delta Tau Data Systems, Inc., (hereafter referred to as DT) in the U.S., however, the ECAT[i] structure elements differ from those of DT controllers. The following table shows the major changes that have been made from DT controllers.

Element name	Description	Change
ECAT[i].Enable	Enabling the EtherCAT	0: Disable, 1: Enable
	network	(2 and 3 are not supported.)
ECAT[i].LPIO[k]	Elements of low priority	Not supported
	I/O module	
ECAT[i].Slave[j]	Slave elements	Not supported
ECAT[i].Error	Error code of enabling	\$ 9811000C: Invalid network
	EtherCAT network	configuration
		\$ 9811002E: Disconnected network
		connection
ECAT[i].LinkUp	Status data structure	Not supported
ECAT[i].LPDomainOutputState	elements	
ECAT[i].LPDomainState		
ECAT[i].LPRxTime		
ECAT[i].LPTxTime		
ECAT[i].MasterStat		
ECAT[i].RTDomainOutputState		
ECAT[i].RTDomainState		

10. Revision History

Revision code	Revised date	Revised content
А	May 18, 2016	First edition

OMRON Corporation Industrial Automation Company

Tokyo, JAPAN

Contact: www.ia.omron.com

Regional Headquarters OMRON EUROPE B.V. Wegalaan 67-69, 2132 JD Hoofddorp The Netherlands Tel: (31)2356-81-300/Fax: (31)2356-81-388

OMRON ASIA PACIFIC PTE. LTD. No. 438A Alexandra Road # 05-05/08 (Lobby 2), Alexandra Technopark, Singapore 119967 Tel: (65) 6835-3011/Fax: (65) 6835-2711

OMRON ELECTRONICS LLC 2895 Greenspoint Parkway, Suite 200 Hoffman Estates, IL 60169 U.S.A Tel: (1) 847-843-7900/Fax: (1) 847-843-7787

OMRON (CHINA) CO., LTD.
Room 2211, Bank of China Tower,
200 Yin Cheng Zhong Road,
PuDong New Area, Shanghai, 200120, China
Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200

Authorized Distributor:

© OMRON Corporation 2016 All Rights Reserved. In the interest of product improvement, specifications are subject to change without notice.

Cat. No. O028-E1-01 0816(0816)