

OMRON

Model **ZN-CTM11-□A**

Split-core Type CT for Portable Power Monitor

INSTRUCTION SHEET

Thank you for selecting OMRON product. This sheet primarily describes precautions required in installing and operating the product.

Before operating the product, read the sheet thoroughly to acquire sufficient knowledge of the product. For your convenience, keep the sheet at your disposal.



Dispose in accordance with applicable regulations.



* 9 5 2 2 0 0 2 - 3 E *

© OMRON Corporation 2011 All Rights Reserved.

PRECAUTIONS ON SAFETY

● Meanings of Signal Words



WARNING

Indicates a potentially hazardous situation which, if not avoided, will result in minor or moderate injury, or may result in serious injury or death. Additionally there may be significant property damage.



CAUTION

Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury or in property damage.

● Meaning of Precaution Symbols



Mandatory Requirement
Indicates a general mandatory requirement.



Prohibition
Indicates general prohibition.



Electric Shock Warning
Warns against an electric shock under specific conditions.



Disassembly Prohibition
Indicates the possibility of accidents such as an electric shock caused by unit disassembly.



WARNING

The ZN-CTX21 Portable Power Monitor sensor head connector and the CT input circuit are not insulated.

Do not connect the dedicated CT terminal and connection cable directly to AC or DC power supply.

Extensive property damage, minor or moderate injury may be caused by the electrical flow through the Portable Power Monitor, if they are connected directly to AC or DC power supply.



CAUTION

A minor or moderate injury or property damage may occur due to explosion. Do not use the product in an environment containing an inflammable or explosive gas.



An electric shock may occur. Make sure that the power of a conductor to be measured is turned OFF before clamping or detaching the unit to/from the conductor. Or wear insulating gloves if the power is not turned OFF.



An electric shock may occur. Do not touch the terminal sections of the unit and the conductor to be measured when the unit is clamped to the conductor.



An electric shock may occur. Be sure to use the covered wire with at least 600 V basic insulation for the primary side wire. Do not use it for busbar.



An electric shock or minor injury as well as fire or unit malfunction may occur. Do not attempt to disassemble, repair or modify the product.



PRECAUTIONS FOR SAFE USE

Observe the following precautions to ensure safe operation.

- Do not install the product in the places subject to exposure to water, oil, or chemical splashes.
- Dispose of the product as industrial waste.
- Do not let the product drop or subject it to a shock, which may cause its damage or malfunction. Stop using the product if it has been applied with a strong impact.
- The product cannot be used for measurement of the secondary circuit of an inverter.

The applicable voltage is 480 V max. Do not use the product with the covered wire with 480 V or higher.

PRECAUTIONS FOR CORRECT USE

1. Avoid installing the product in the following places:

- Places exceeding the rated ambient temperature
- Places exposed to extreme temperature changes (where condensation occurs)
- Places subject to relative humidity exceeding the rated humidity range
- Places subject to corrosive or flammable gases
- Places subject to mist, droplets, coarse particles, fiber, salt, metal dust, or large amount of particles
- Places subject to direct shock or vibration
- Places subject to direct sunlight
- Places subject to exposure to water, oil, or chemical splashes
- Places subject to strong magnetic field or electric field
- Outdoors

2. Wiring

- Wire the product cable separately from high-voltage or power lines. Placing them in the same wiring or the same duct may cause induction, resulting in the product malfunction or damage.

3. Clamping to measured conductor

- Check the direction of the power supply side (K) and load side (L) before placing the clamp. Placing the clamp in wrong direction will result in measurement error.
- Spread the dedicated CT branching/fixing hook and place the clamp. Let the hook clamp the wire by pressing it until it clicks.
- Do not remove/insert the sensor head connector with the measured conductor clamped. Doing so may result in failure of the main unit and dedicated CT.
- Do not place the clamp on the measured conductor with the power supply of the main unit OFF. Doing so may result in failure of the main unit and dedicated CT.

4. Others

- When carrying the dedicated CT mounted on the Portable Power Monitor, hold the CT by a hand to prevent an excessive pressure from being applied to the crimp terminal.
- Do not ground the dedicated CT. Doing so may result in failure.
- When performing measurement using multiple CTs, a Portable Power Monitor (ZN-CTX21-□) and branch cable (ZN-CTM11-C) (sold separately) are required.

To check your current version and information on version upgrade, visit the following website:


<http://www.fa.omron.co.jp/member/product/tool/245/zn/index.htm>

- Do not connect clamp-on CT (ZN-CTM51-□A) and split-core CT (ZN-CTM11-□A) at the same time to one Portable Power Monitor. Doing so may result in measurement error.
- Carefully install the dedicated CT not to drop it on your feet.

Ratings

Model	ZN-CTM11-5A	ZN-CTM11-50A	ZN-CTM11-100A	ZN-CTM11-200A	ZN-CTM11-400A
Item					
Primary side rated current	5 A	50 A	100 A	200 A	400 A
Secondary winding	3,000 turns				6,000 turns
Applicable frequency	10 Hz to 5 kHz				
Insulation resistance	Between output terminal and case: 50 MΩ min. (500 VDC)				
Withstand voltage	Between output terminal and case: 2,000 VAC for 1 minute				
Protection device	7.5 V clamp device				
The number of detach operations allowed	100 times				
Available wire diameter	7.9 mm dia. max.	9.5 mm dia. max.	14.5 mm dia. max.	24.0 mm dia. max.	35.5 mm dia. max.
Operating temperature/humidity	-20 to 60°C 85% max. (no icing or condensation)				
Storage temperature/humidity	-30 to 65°C 85% max. (no icing or condensation)				
Used circuit voltage	480 VAC max.				

Nomenclature

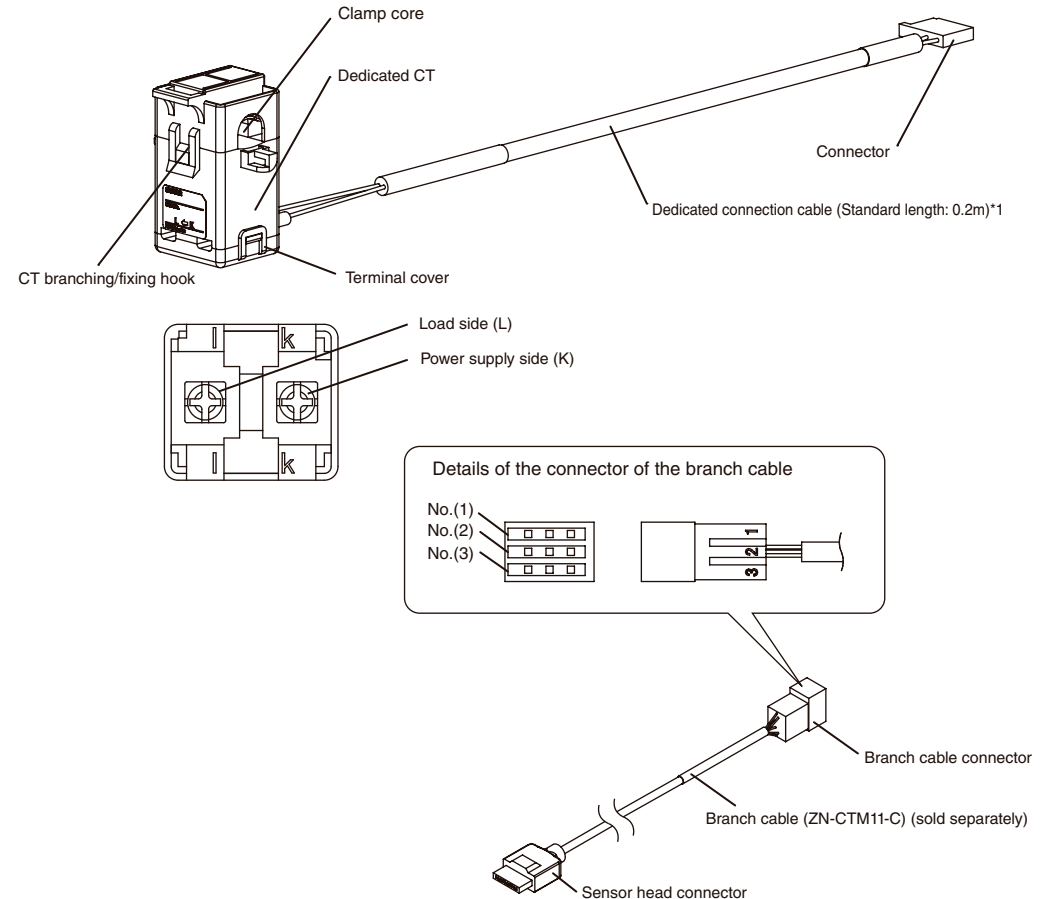

*1 The dedicated connection cable is attached to the unit by the factory default. When replacing the terminals, connect the K side of the connection cable to the power supply side (K) of the CT terminal and the L side of the cable to the CT terminal load side (L).

A recommended tightening torque: 0.69 to 0.88N•m

Suitability for Use

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

OMRON Corporation

Kyoto, JAPAN

Industrial Automation Company

Contact: www.ia.omron.com

Regional Headquarters

■ OMRON EUROPE B.V.

Wegalaan 67-69, 2132 JD Hoofddorp

The Netherlands

Tel: (31)2356-81-300/Fax: (31)2356-81-388

■ OMRON ELECTRONICS LLC

2895 Greenspoint Parkway, Suite 200

Hoffman Estates, IL 60169 U.S.A.

Tel: (1) 847-843-7900/Fax: (1) 847-843-7787

■ OMRON ASIA PACIFIC PTE. LTD.

438B Alexandra Road, #08-01/02 Alexandra

Technopark, Singapore 119968

Tel: (65) 6835-3011 / Fax: (65) 6835-3011

■ OMRON (CHINA) CO., LTD.

Room 2211, Bank of China Tower,

200 Yin Cheng Zhong Road,

PuDong New Area, Shanghai, 200120, China

Tel: (86) 21-6023-0333 / Fax: (86) 21-5037-2388

■ OMRON Canada Inc.

1675 Trans Canada Route Suite 105,

Dorval, Quebec H9P 1J1, Canada

D

May, 2025