

OMRON

## 形 ZN-THX11-S□

高精度温湿度口ガ-

## 取扱説明書

このたびは、本製品をお買い上げいただきまして、まことにありがとうございます。  
ご使用に際しては、次の内容をお守りください。  
・電気の知識を有する専門家が扱ってください。  
・この取扱説明書をよくお読みになり、十分にご理解のうえ、正しくご使用ください。  
・この取扱説明書はいつでも参照できるように大切に保管してください。



\* 2 1 5 5 6 0 4 - 6 K \*

© OMRON Corporation 2010-2018 All Rights Reserved.

## ● 米国カリフォルニア州過塩素酸塩規制について

この製品はカリフォルニア州法で規制されている過塩素酸塩を含むリチウム電池を内蔵しておりますのでこの州法への対応をしてください。  
詳しくは、下記URLを御覧ください。  
<http://www.fa.omron.co.jp/product/rohs/perchlorate.html>

## 安全上のご注意

## ● 警告表示の意味



正しい取扱いをしなければ、この危険のために、軽傷・中程度の傷害を負ったり、万一の場合には重傷や死亡に至る恐れがあります。また、同様に重大な物的損害をもたらす恐れがあります。

## ● 図記号の意味



● 分解禁止  
機器を分解することで、感電などの障害が起こる可能性を示します。



● 破裂注意  
特定の条件において、破裂する可能性を示します。

## ● 警告表示



リチウム電池を内蔵しており、発火、破裂、燃焼により重度の障害がまれに起こる恐れがあります。廃棄時は産業廃棄物として処理し、本体の分解、加圧変形、加熱、焼却などは絶対にしないでください。



感電により稀に怪我をする恐れがあります。分解したり内部に触ったりしないでください。



## 安全上の要点

本製品を安全に使用するため、以下のことを守ってください。  
・水・油・化学薬品の飛沫がある場所には設置しないでください。  
・ACアダプタ使用時は付属のACアダプタ以外は使用しないでください。  
・DCケーブルは、必ず付属のものをご使用ください。  
・ACアダプタ及びDCケーブルに定格電圧を超える電圧が印加されると、発煙の恐れがあります。定格を超える電源は接続しないでください。定格を超える電圧がかかることが想定される場合には、保護機器などを使用し、電源電圧が定格電圧を超えないようにしてください。  
・廃棄する時は、産業廃棄物として処理ください。  
・電池はメーカー記載の注意事項をよくお読みの上、正しくお使いください。  
・破損・誤動作の可能性があるため、本製品を落とさせるなどの強い衝撃を与えないでください。落下による破損防止のため、壁面などに取り付ける際はねじ止め固定を推奨します。強い衝撃を与えた場合、使用を中止してください。  
・落下による破損防止のため、SDカードを出し入れる際は本体を持ってください。また、電源ケーブル、アラーム出力ケーブル、センサコネクタを抜き差しする場合も本体を持ってください。  
・発煙の恐れがあるため、アラーム出力端子には適切な負荷を取り付けてください。  
・液晶パネルが破損し、液晶が漏れ出た場合は皮膚と接触したり吸入したり飲み込んだりしないようしてください。万一、皮膚に触れたり口に入ってしまった場合は医師の診断を受けてください。  
■ Applicable standards  
・EN61326-1  
・Electromagnetic environment : Industrial electromagnetic environment (EN/IEC 61326-1 Table 2)


## 使用上の注意

## 1. 下記の設置場所では使用しないでください。


・周囲温度が定格の範囲を超える場所  
・温度変化が激しい場所（結露する場所）  
・相対湿度が定格の範囲を超える場所  
・腐食性ガス、可燃性ガスがある場所  
・ミスト、液滴、粗大粒子、繊維、塩分、金属粉など、もしくは大量の粒子がある場所  
・振動や衝撃が直接加わる場所  
・直射日光が当たる場所  
・水・油・化学薬品の飛沫がある場所  
・強磁界・強電界がある場所  
・屋外

## 2. 配線について

・形ZN-THX11-SAをご使用の際には、付属のDCケーブルの白いラインが入っている方を電源（DC24V±10%）に、ラインが入っていない方を0Vに接続してください。

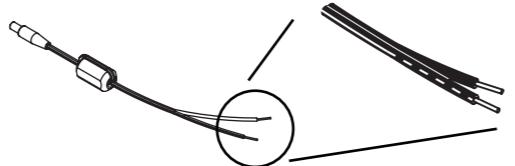

・DCケーブルで電源供給する場合、フェライトコアを取り付けることで、他機器に与えるノイズや他機器より受け取るノイズを軽減することができます。付属のDCケーブルをご使用の際には、付属のフェライトコアを下図のように巻きつけてください。

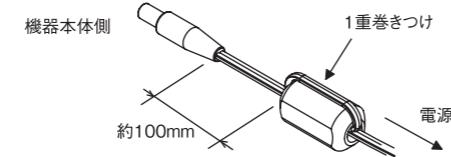

・高圧線、動力線と本製品の配線は別配線してください。同一配線あるいは同一ダクトにすると誘導を受け、誤動作あるいは破損の原因になることがあります。

・入出力端子の着脱は必ず電源を切った状態で行ってください。電源が入ったまま行うと故障の原因になります。

・本製品には形ZN-THS1□□-S以外のセンサヘッドは接続しないでください。また、本体にセンサヘッドを取り付けた状態でヘッド部のみを持たないでください。

## 3. 電池使用に関して

・誤動作の原因となりますので、新しい電池と古い電池やメーカー形式の異なる電池を混用しないでください。

・極性を間違えて挿入しないでください。

・使用中は電池カバーを必ず装着してください。電池カバーを装着せず、電池がはずれた場合、装置の動作は保証できませんのでご注意ください。

・長時間使用しないときは、電池を装置から取り出してください。使用済み電池を長時間装着しておくと、電池の液漏れにより装置を腐食することがあります。

・電池を分解したり、火中に投入しないでください。

・電池残量が少ない場合、再起動が繰り返される場合があります。このような現象が発生した場合、新しい電池に交換してください。

## 4. 電池の廃棄に関して

・交換後の電池の廃棄については、地方自治体により規制を受ける場合があります。それぞれの自治体規制に従って廃棄してください。

## 5. 本体底面のシールに関して

・弊社内でのメンテナンス用途として使用するコネクタがありますので、本体底面に貼り付けてあるシールは絶対に剥がさないでください。

## 6. 取り付けネジ穴について

・ネジ穴はM3、深さ4mmです。本体破損のおそれがありますので、4mm以上のネジ締めは行わないでください。

## 7. 長期間の保管に関して

・長期間使用されないときは、高温にならない場所に保管してください。


・内蔵しているリチウム電池を長持ちさせることができます。

## ■ 形式について

ZN-THX11-S□

なし: ACアダプタ（PSE）同梱タイプ  
A: DCケーブル同梱タイプ

## ■ 外形図

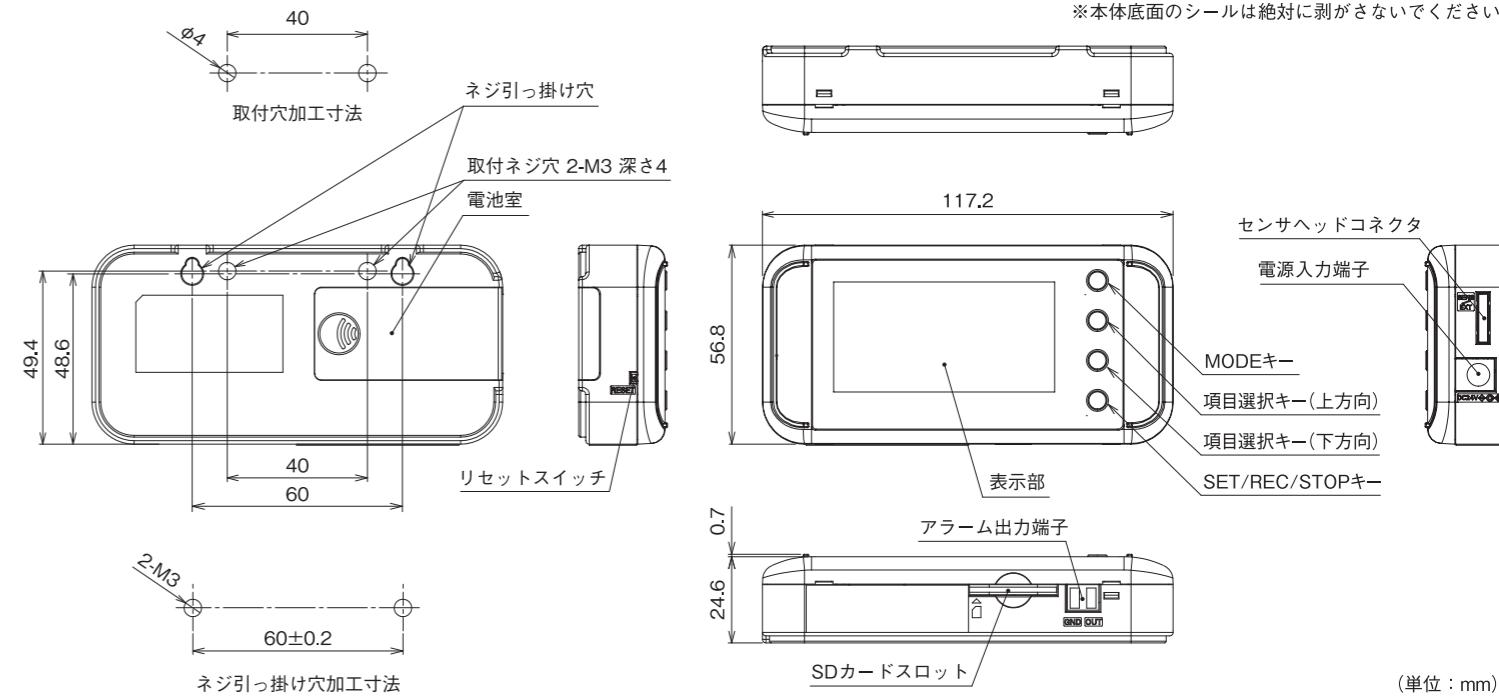

※本体底面のシールは絶対に剥がさないでください

## ■ 定格

項目	形式	ZN-THX11-S□
接続可能センサ		温湿度センサヘッド（形ZN-THS1□□-S）
表示		液晶7セグ5桁2段表示 補助情報インジケータ表示
計測間隔		10s, 20s, 30s, 1min, 2min, 5min, 10min, 20min, 30min, 1h
演算機能		瞬時値、最大値、最小値、平均値
動作モード		通常モード、スリープモード*1
記録モード		コンティニュー*2、リング*3
外部出力		アラーム出力*4（フォトカプラ出力）
記憶装置（内部）		内部メモリ 約8500データ
記憶装置（外部）		SDカード（SDHC対応、計測値の保存/設定値の保存/読み出し） 推奨SDカード: 形HMC-SD292（2GB）、形HMC-SD492（4GB）（オムロン（株）製）*5
電源電圧		DC入力: DC24V±10% ACアダプタ: AC100~240V/50~60Hz 電池: 単4電池2本
消費電流		80mA以下（DC24Vにて） 70mA以下（ACアダプタ使用時）
電池寿命*6		約1年（単4ニッケル水素電池2本でスリープモード、計測間隔10分、SDカード未挿入状態にて）
使用温度範囲		本体: 0~60°C ACアダプタ: 0~40°C
保存温度範囲		-15~+60°C（結露、氷結しないこと）
使用湿度範囲		20~85%RH（結露なきこと）
保存湿度範囲		20~85%RH（結露、氷結しないこと）
絶縁抵抗		20MΩ（DC500Vメガにて）
耐電圧		AC1000V、50/60Hz 1min
振動（耐久）		10~150Hz 複振幅0.7mm 加速度50m/s <sup>2</sup> X、Y、Z各方向 80min *7
衝撃（耐久）		150m/s <sup>2</sup> 6方向各3回（上下、左右、前後） *7
材質		ABS
保護構造		IP30
取付方法		ネジ取り付け・引っ掛け・据置設置
重量（梱包状態）		約500g
付属品		取扱説明書、スタートアップガイド、ACアダプタ*8、DCケーブル*8、フェライトコア*8、アラーム出力コネクタ*9

\*1 省電力モード。デフォルト設定では表示が常時消灯します。（ボタン操作で点灯します）

\*2 内部メモリが上限に達した時点で自動的にSDカードにデータを書き出してSDカードの容量いっぱいまで記録を継続します。内部メモリが上限に達した時点でSDカードが挿入されていない場合は記録が停止します。（SDカード挿入後ボタン押下でSDカードに出力できます。）

\*3 常に内部メモリ上限分、最新の計測値を記録するモードです。（内部メモリ上限を超える場合は最も過去のデータから逐次破棄されます）

\*4 しきい値設定モードで設定された上限値あるいは下限値を超えた場合に出力されます。

\*5 他社製のSDカードをご使用になる場合は、信頼性、耐久性の高い産業用SDカード（SD規格またはSDHC規格（SDXC規格には非対応）、Class4以上のフラッシュメモリがSLCまたはMLCのタイプ）を推奨します。動作確認は、お客様自身でお願いします。

\*6 電池寿命は測定環境、サンプリング、動作モード、電池の種類や性能により異なります。

\*7 取付磁石 形ZN9-EM01-S（別売）をご使用の際は、衝撃が加わらない箇所に設置ください。

また、振動（耐久）は10~55Hz 複振幅0.3mm 加速度20m/s<sup>2</sup> X、Y、Z各方向 50min になります。


\*8 ZN-THX11-Sは、ACアダプタが同梱されています。ZN-THX11-SAは、DCケーブルとフェライトコアが同梱されています。

\*9 付属のコネクタはオムロン製 形XW4B-02B1-H1です。

## ■ 取付方法


本製品は精密機器です。取り付け時の落下にはご注意ください。  
本体を落させたり、強い衝撃を与えないでください。  
落下させたり衝撃を与えた場合、使用を中止してください。

### 1. 取付ネジ穴を使う場合

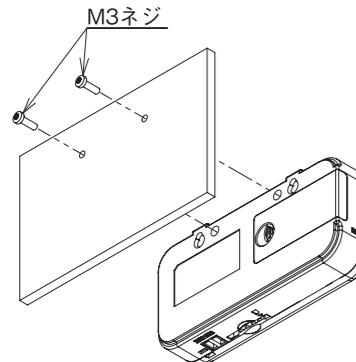


本体ネジ穴の深さは4mmです。4mm以上のネジ締めを行わないようご注意ください。


ネジ穴に取付マグネット形ZN9-EM01-S（別売）を取付けることによって、磁石による固定が出来ます。（締め付けトルク 0.4N/cm～0.6N/cm）磁石取付時はセンサヘッドおよびケーブル類の荷重が本製品に加わらないよう、ケーブルの引き回しにご注意ください。（形ZN-THS17-S以外）

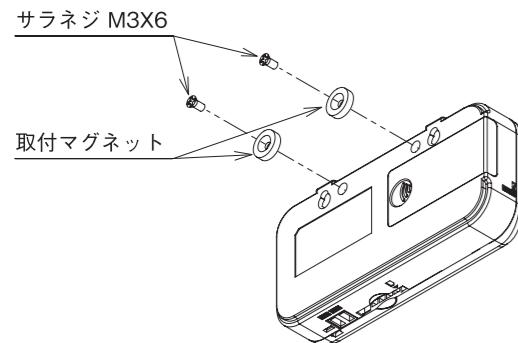

### 2. ネジ引っ掛け穴を使う場合

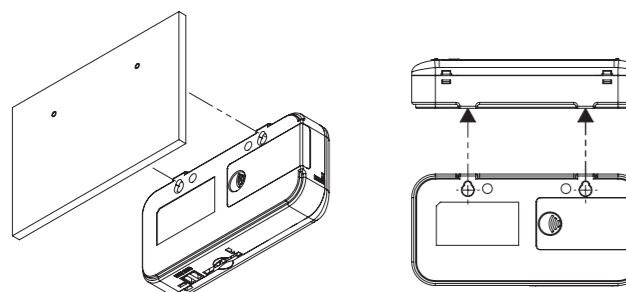


本体上部の凸部分直下(2箇所)に引っ掛け穴があります。M3ネジを使用してネジ引っ掛け穴にネジ頭を引っ掛けてください。ネジ頭底面と壁面からの距離は2.5mm以上あけてください。

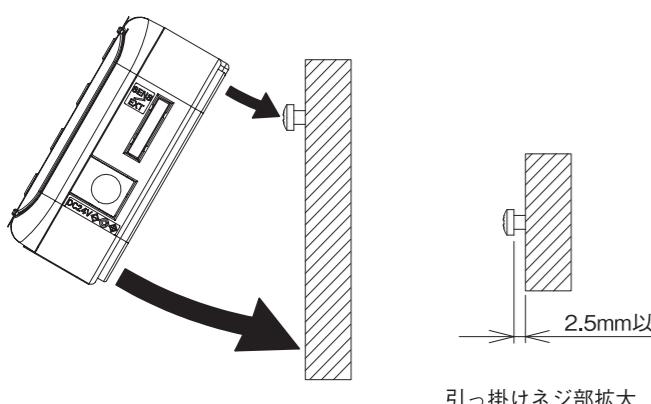

## 3. 据置設置

机上などに本製品を置いてご使用ください。

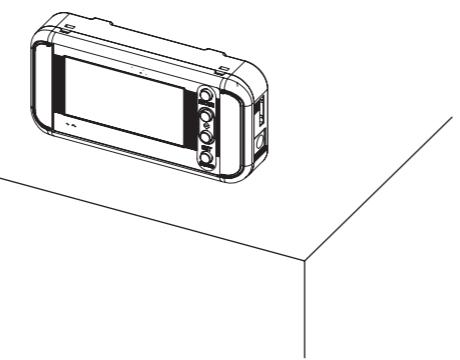

### 4. センサ部の取付

本体右側面のセンサヘッドコネクタ（メス）に温湿度センサヘッド（形ZN-THS1□□-S）のコネクタ（オス）を挿入してください。センサヘッドを取り付けた状態で持ち運ぶ場合、ロガー本体を保持し、センサヘッドへ過度な力が掛からないようにしてください。

### 5. SDカード挿入

本体下部のSDカードスロットにSDカードを挿入してください。SDカードの端子面を本体前面側に向けて挿入してください。

### 6. アラーム出力端子の取付

出力仕様に従い、OUTとGNDを負荷に接続してください。アラーム出力コネクタに信号線を挿入し、マイナスドライバーで締め付けてください。

### 7. 電源の投入

DCケーブルまたは付属のACアダプタを用い、電源入力端子に電源を供給してください。電池を使用する場合は単4電池2本を本体背面の電池室へ装着してください。


・ DCケーブルまたは付属のACアダプタを使用し、外部から電源供給する場合



ACアダプタまたはDCケーブルのプラグを本体の電源供給端子に挿します。

・電池を使用する場合

本体背面の電池カバーを取り外し、極性に注意して電池を装着してください。装着後、電池カバーを取り付けてください。

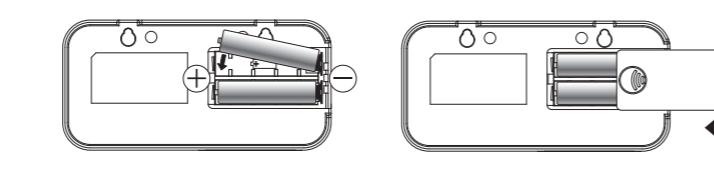

引っ掛けネジ部拡大

## ■ アラーム出力端子


端子名は本体に刻印されています。  
端子台に用いる電線に関して、以下の点にご注意ください。  
電線の長さ:30m以下  
(1)OUT  
THRモードで割り当てられた判定結果を出力します。  
(2)GND  
コモン端子です。

## ■ 出力仕様

OUT,GND間に外部電源を直接接続しないでください。  
必ず負荷を接続してください。

外部電源電圧	DC12～24V ±10%
負荷電流	45mA 以下
ON 残留電圧	2V 以下
OFF 漏れ電流	0.1mA 以下
内部回路図	

## ■ 各部の名称・機能

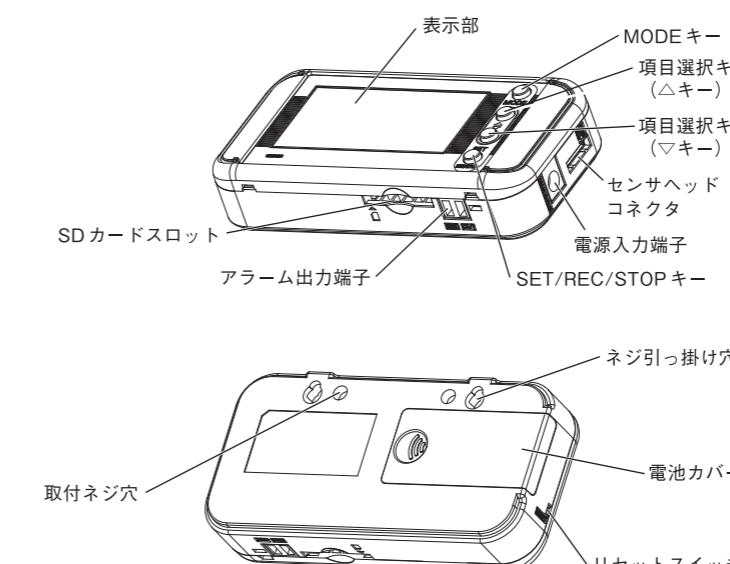

名称	機能
MODEキー	動作モードの切り替え エラー、アラームの解除（長押し） 設定中のキャンセル
項目選択キー（△キー）	設定項目の移動（上方向） 表示画面の切り替え（逆順方向） 設定値の変更（増加）
項目選択キー（▽キー）	設定項目の移動（下方向） 表示画面の切り替え（順方向） 設定値の変更（減少）
SET/REC/STOPキー	設定値などを確定 収録の開始／停止（長押し） 収録データのSDメモリカードへの保存
取付ネジ穴	ネジ留め固定用（M3×4mmメス穴）
ネジ引っ掛け穴	ネジ引っ掛け用
電池カバー	電池室カバー
リセットスイッチ	本体の再起動*

\*収録停止時にSDカードが無く、エラー復旧できない場合などに使用

## ■ 概要・特徴

形ZN-THX11-S□では専用センサヘッド形ZN-THS1□□-S（別売り）と接続することによって温度・相対湿度・時刻の表示および各種計測動作の設定を行うことができます。

### ●表示、判定出力

計測した温度/湿度および時刻表示は▲、▼キーで表示を切り替えることが出来ます。また、監視対象の計測値を選択、しきい値を設定し、出力端子からアラーム出力させることができます。

### ●データ出力・観察

本体メモリへ計測値を記録し、記録済み計測値をCSV形式ファイルでSDカードへ保存することができます。  
製品ページからダウンロード可能なPCソフトを使用することによって、SDカードへ保存されたファイルをグラフ表示することができます。  
SDカードが未フォーマットの場合、必ず使用する前にフォーマットして下さい。  
フォーマットソフト入手先:  
[http://www.sdcard.org/jp/downloads/formatter\\_4/](http://www.sdcard.org/jp/downloads/formatter_4/)

## ■ 校正について

本製品の校正は不要です。校正は温湿度センサヘッド（形ZN-THS1□□-S）に対して実施してください。

## ご承諾事項

当社商品は、一般工業製品向けの汎用品として設計・製造されています。従いまして、次に掲げる用途での使用を意図しておらず、お客様が当社商品をこれらの用途に使用される際には、当社は当社商品に対して一切保証をいたしません。ただし、次に掲げる用途であっても当社の意図した特別な商品用途の場合や特別の合意がある場合は除きます。

- (a) 高い安全性が必要とされる用途（例：原子力制御設備、燃焼設備、航空・宇宙設備、鉄道設備、昇降設備、娯楽設備、医用機器、安全装置、その他生命・身体に危険が及ぶる用途）
- (b) 高い信頼性が必要な用途（例：ガス・水道・電気等の供給システム、24時間連続運転システム、決済システムほか権利・財産を取扱う用途など）
- (c) 厳しい条件または環境での用途（例：屋外に設置する設備、化学的汚染を被る設備、電磁的妨害を被る設備、振動・衝撃を受ける設備など）
- (d) カタログ等に記載のない条件や環境での用途

\* (a)から(d)に記載されている他、本カタログ等記載の商品は自動車（二輪車含む。以下同じ）向けではありません。自動車に搭載する用途には利用しないで下さい。自動車搭載用商品については当社営業担当者にご相談ください。

\*上記は適合用途の条件の一部です。当社のベスト、総合カタログ、データシート等最新版のカタログ、マニュアルに記載の保証・免責事項の内容をよく読んでご使用ください。

**オムロン株式会社 インダストリアルオートメーションビジネスカンパニー**

●製品に関するお問い合わせ先  
お客様相談室

■フリーダイヤル 0120-919-066  
携帯電話・PHS・IP電話などではご利用いただけませんので、下記の電話番号へおかけください。  
電話 055-982-5015 (通話料がかかります)

■お問い合わせ  
オムロンFAクイックチャット  
[www.fa.omron.co.jp/contact/tech/chat/](http://www.fa.omron.co.jp/contact/tech/chat/)  
技術相談員にチャットでお問い合わせいただけます。  
(i-Webメンバーズ限定)

■営業時間：9:00～17:00 (土曜日、日曜日、12月31日～翌年1月3日を除く)

●FAXやWebページでもお問い合わせいただけます。  
FAX 055-982-5051 / [www.fa.omron.co.jp](http://www.fa.omron.co.jp)

●その他のお問い合わせ  
納期・価格・サンプル・仕様書は貴社のお取引先、または貴社担当オムロン販売員にご相談ください。  
オムロン制御機器販売店やオムロン販売拠点は、Webページでご案内しています。

A(X) 2024年12月

**OMRON****ZN-THX11-S****Air Thermo Logger****INSTRUCTION SHEET**

Thank you for selecting OMRON product. This sheet primarily describes precautions required in installing and operating the product. Before operating the product, read the sheet thoroughly to acquire sufficient knowledge of the product. For your convenience, keep the sheet at your disposal.

**TRACEABILITY INFORMATION:**

Importer in EU:  
Omron Europe B.V.  
Wegalaan 67-69  
2132 JD Hoofddorp,  
The Netherlands

Manufacturer:  
Omron Corporation,  
Shiokoji Horikawa, Shimogyo-ku,  
Kyoto 600-8530 JAPAN

The following notice applies only to products that carry the CE mark:

Notice:  
This is a class A product. In residential areas it may cause radio interference, in which case the user may be required to take adequate measures to reduce interference.



© OMRON Corporation 2010-2018 All Rights Reserved.

**● Perchlorate regulations by the State of California, USA**

This product uses a lithium battery that contains perchlorate that is regulated by California State Law. Appropriate measures must be taken to comply with regulations.

For details, refer to the URL as below:

[www.dtsc.ca.gov/hazardouswaste/perchlorate](http://www.dtsc.ca.gov/hazardouswaste/perchlorate)

**PRECAUTIONS ON SAFETY****● Meanings of Signal Words**

Meanings of Signal Words Indicates a potentially hazardous situation which, if not avoided, will result in minor or moderate injury, or may result in serious injury or death. Additionally there may be significant property damage.

**● Definition of Symbols**

● Disassembly Prohibition  
Indicates that disassembly is prohibited to prevent electric shock.



● Explosion Caution  
Indicates the possibility of explosion under specific conditions.

**● Warning Indications**

As this product contains a lithium battery, fire, explosion or burning hazards may occur. Dispose of the product as industrial waste. Do not disassemble, deform, heat, or burn this product.



Do not disassemble or touch inside the unit. Doing so may result in electric shock and/or injury.

**PRECAUTIONS FOR SAFE USE**

Observe the following precautions to ensure safe operation.

- Do not install the product in the places subject to exposure to water, oil, or chemicals.
- When using an AC adapter, use the provided AC adapter only.
- Be sure to use the provided DC cable.
- If a voltage that exceeds the rated voltage is applied to the AC adapter or DC cable, smoking may occur. Do not connect a power supply that exceeds the rated voltage. In a situation where a voltage higher than the rating is applied, use protective equipment for the power supply not to exceed the rated voltage.
- Dispose of the Air Thermo Logger as industrial waste.
- To use the batteries properly, read the precautions written by manufacturer before use.
- Do not subject the product to a shock such as dropping the product. Doing so may cause damage to or malfunction of the product. It is recommended to secure screws when mounted on the wall surface to prevent damage from dropping the product. If strong impact is applied to the product, stop using the product.
- When inserting or pulling out the SD card, hold the main unit to prevent damage from dropping the product. When inserting or pulling out an AC adapter, alarm output cable or sensor connector, hold the unit as well.
- Mount an appropriate load on the alarm output terminals due to the possibility of smoking.
- If liquid crystal leaks due to a damage to the LCD panel, be careful so that your skin will not touch with or you will not inhale or swallow it. If liquid crystal enters into your mouth, seek medical attention.

Dispose of in accordance with WEEE Directive

**Applicable standards**


• EN61326-1  
• Electromagnetic environment : Industrial electromagnetic environment (EN/IEC 61326-1 Table 2)

**PRECAUTIONS FOR CORRECT USE****1. Avoid installing the product in the following places:**


- Places exceeded the rated ambient temperature
- Places exposed to extreme temperature changes (prevent condensation.)
- Places exceeded the rated RH level
- Places subject to corrosive or flammable gases
- Places subject to mist, droplets, coarse particles, fiber, salt, metal dust, or large amount of particles
- Places subject to direct shock or vibration
- Places subject to direct sunlight
- Places subject to exposure to water, oil, or chemicals
- Places subject to strong magnetic field or electric field
- Outdoors

**2. Wiring**

- When using the ZN-THX11-SA, connect the provided DC cable with the white line to the power supply (24 VDC±10%), and the cable with no line to 0 V.

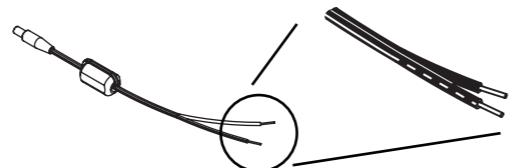

When supplying power with a DC cable, mount a ferrite core to reduce noise given to or received from other devices. When using the provided DC cable, place the cable around the provided ferrite core.

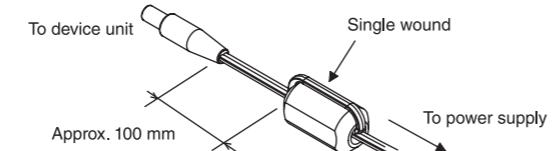

Lay the product cable away from any high-voltage cable or power line. If laid in the same conduit or duct, induction noise from them may cause malfunction or breakdown of the product.

Be sure to turn the power OFF before inserting or removing the I/O terminals. Otherwise it may result in a failure.

Do not connect the product to a sensor head other than ZN-THS1□□-S. Do not hold only the sensor head mounted to the product body.

**3. Battery Use**

Do not combine use of new and old batteries, or do not use batteries in combinations with those of different makers or models. Doing so may result in malfunction.

Do not insert a battery with the polarity inverted.

Be sure to mount a battery cover during use. Be careful that the operation of the device cannot be guaranteed if a battery is removed because the battery cover is not mounted.

Remove the batteries if you do not use the product for a long period of time. If leaving the used batteries in the product for a long period of time, corrosion of the device may occur due to a battery leak.

Do not disassemble or throw the battery into the fire.

When the battery level is low, a restart may be repeated. If such event occurs, replace the batteries with new ones.

**4. Battery Disposal**

For disposal of batteries after replacement, restrictions may apply depending on the local government. Dispose of the batteries according to your local government.

**5. Seal at the Bottom of the Unit**

Never remove the seal at the bottom of the unit as there is a connector used for maintenance purpose conducted by OMRON.

**6. Mounting screw holes**

The screw hole is M3 and the depth of the screw is 4 mm. Do not tighten a screw with more than 4 mm in depth. Doing so may damage the product.


**7. Long Term Storage**

If the product will not be used for a long period of time, store the product in the location where the temperature is not too high. This ensures longer life of the built-in lithium battery.

**■ Model number legend**

ZN-THX11-S□

None: AC adapter(PSE) included  
A: DC cable included

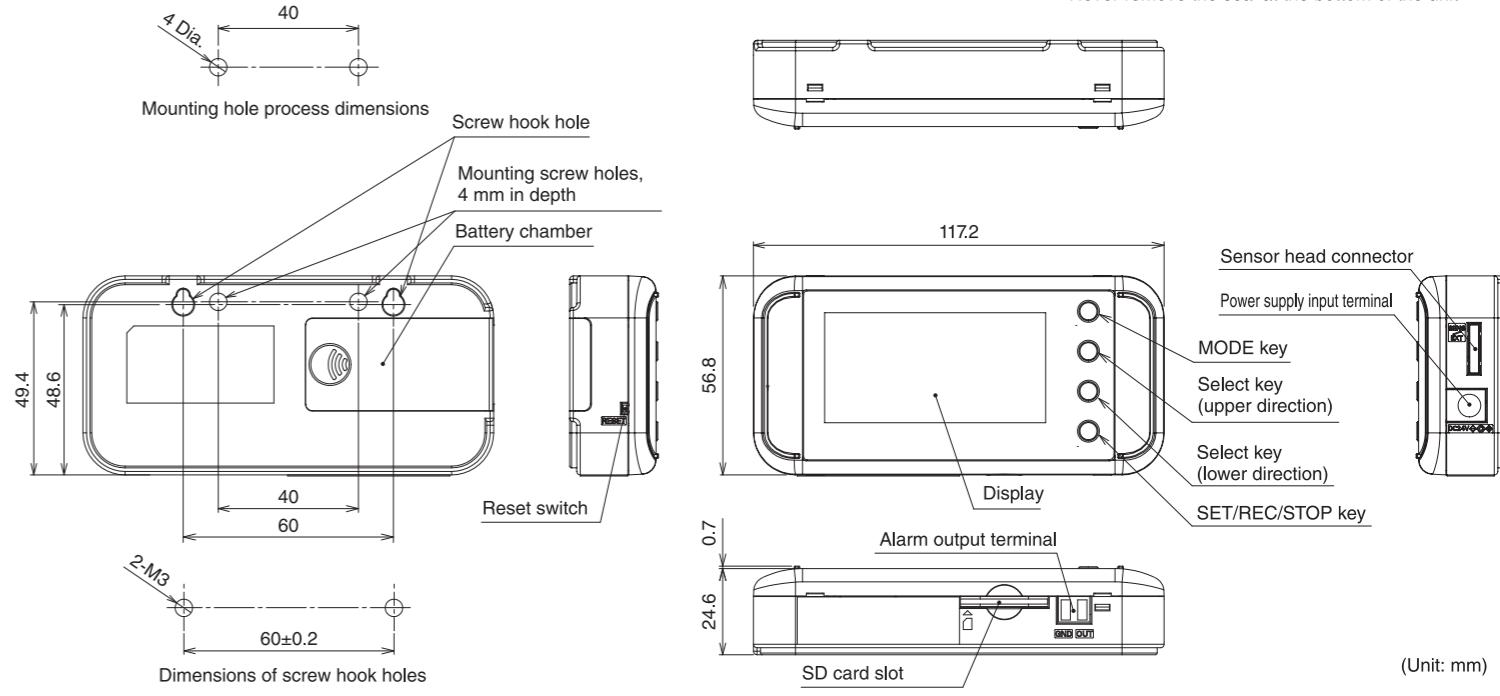**■ Dimensions**

\*Never remove the seal at the bottom of the unit.

**■ Ratings**

Model	ZN-THX11-S□
Item	Air Thermo Sensor Head (ZN-THS1□□-S)
Sensor that can be connected	LCD 7-segment 5-digit 2-step display, auxiliary information indicator display
Display	10 s, 20 s, 30 s, 1 min, 2 min, 5 min, 10 min, 20 min, 30 min, 1 h
Measurement interval	Instantaneous value, maximum value, minimum value, average value
Calculation function	Normal mode, sleep mode*1
Operating mode	Continue*2, ring*3
Recording mode	Alarm output *4 (Photocoupler output)
External output	Internal memory: Approx. 8,500 data items
Internal storage device	SD card (SDHC support, measured value saving/set value saving and reading) Recommended SD card: HMC-SD292(2GB)/HMC-SD492(4GB) (manufactured by OMRON)*5
External storage device	SD card (SDHC support, measured value saving/set value saving and reading) Recommended SD card: HMC-SD292(2GB)/HMC-SD492(4GB) (manufactured by OMRON)*5
Power supply voltage	DC input: 24 VDC±10%, AC adapter: 100 to 240 VAC/50 to 60 Hz, Battery: 2 AAA batteries
Current consumption	80 mA max. (24 VDC), 70 mA max. (AC adapter used)
Battery life*6	Approx. 1 year (sleep mode, measurement interval of 10 minutes with 2 AAA nickel metal hydride batteries, with SD card not inserted)
Operating temperature range	Main unit: 0 to 60°C, AC adapter: 0 to 40°C
Storage temperature range	-15 to +60°C (no condensation or icing)
Operating humidity range	20 to 85% (no condensation)
Storage humidity range	20 to 85% (no condensation or icing)
Insulation resistance	20 MΩ (500 VDC)
Withstand voltage	1000 VAC, 50/60 Hz 1 min
Vibration resistance	10 to 150 Hz, 0.35 mm double amplitude, acceleration: 50 m/s² for each in X, Y and Z directions for 80 min*7
Shock resistance	150 m/s² in 6 directions (+/-X, +/-Y, and +/-Z directions), 3 times each*7
Material	ABS
Degree of protection	IP30
Mounting method	Screw mounting, hook, standing installation
Weight (packaged)	Approx. 500 g
Accessories	Instruction Sheet, Startup Guide, AC adapter*8, DC cable*8, ferrite core*8, Alarm output connector*9

\*1 Power saving mode. The indicator is always OFF in default setting. (Turns ON with button operation.)

\*2 It automatically writes data to the SD card when reaching the upper limit of the internal memory, and keeps recording until the capacity limit of the SD card. If the SD card is not inserted when the internal memory reaches the upper limit, recording stops. (Data can be output to the SD card by pressing the button after inserting the SD card.)

\*3 This mode always records the latest measured values for the upper limit of the internal memory. (When the measured values exceed the upper limit of the internal memory, the data items will be deleted beginning with the oldest data item.)

\*4 An alarm is output when exceeding the upper limit value or lower limit value that has been set in threshold setting mode.

\*5 When using third party SD card, please use industrial SD card (flash memory is SLC type) with high reliability and durability. Available SD card is SD standard or SDHC standard, Class 4 or higher, (SDXC standard can not be used) You must confirm the operation third party SD card yourself.

\*6 Battery life differs depending on measurement environment, sampling, operating mode, battery type or performance.

\*7 When using Mounting Magnet ZN9-EM01-S (sold separately), install the product in a location where impact is not applied Vibration resistance is 10 to 50 Hz, double amplitude 0.3 mm, acceleration 20 m/s², 50 min for each in X, Y and Z directions.

\*8 An AC adapter is included in the ZN-THX11-S. A DC cable and ferrite core are included in the ZN-THX11-SA.

\*9 The provided connector is OMRON's XW4B-02B1-H1.

